



DOMA CONCEPTS LLC
March 15, 2021

Exterior Finishes

Vinyl Siding, Architectural Plastics, PVC and Fiberglass

Primer: B51W00150 - EX BOND PRM WH

2 Coats: K43W00051 - resilience® Exterior Acrylic Latex Satin Extra White




SHERWIN-WILLIAMS®

Reference Pages

Data Pages



**SHERWIN
WILLIAMS.**

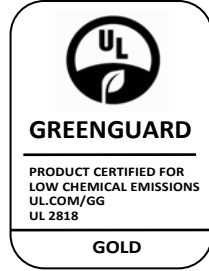

108.51

EXTREME BOND™

Interior/Exterior Bonding Primer

B51W00150 (US)
B51WQ0150 (Canada)

As of 12/08/2016, Complies with:			
OTC	Yes	LEED® 09 NC, CI	Yes
OTC Phase II	Yes	LEED® 09 CS	Yes
SCAQMD	Yes	LEED® 09 H & S	Yes
CARB	Yes	LEED® v4 Emissions	Yes
CARB SCM 2007	Yes	LEED® v4 VOC	Yes
Canada	Yes	MPI	Yes

CHARACTERISTICS

Extreme Bond Primer is a high quality, waterborne, acrylic, primer. Designed for coating hard, slick, glossy surfaces with minimal surface preparation.

Because of the exceptional adhesion of this product, sanding may not be necessary for most clean, paintable surfaces.

- Promotes adhesion on hard to paint surfaces
- Tightly bonds to slick and glossy surfaces
- Assures uniform appearance of topcoats
- One coat application
- Fast dry
- Universal, will accept Hi-Performance coatings such as epoxies and urethanes
- Assures adhesion of the topcoat to slick, glossy surfaces

Interior & Exterior for use on these surfaces:

- PVC Piping
- Plastics
- Glass
- Wall Laminate
- Glossy Surfaces
- Aluminum
- Kitchen Cabinets
- Fiberglass
- Varnished Woodwork
- Ceramic Wall Tile
- Previously Painted Surfaces
- Glazed Block
- Fluoropolymer coatings

EXTERIOR USE

When priming larger exterior pre-finished metal surfaces where exterior maximum adhesion is needed, use DTM Bonding Primer.

CHARACTERISTICS

Color: White Base

Coverage: 450-500 sq ft/gal (11.04-12.27 m²/L)
@ 3.1 mils wet; .9 mils dry

Drying Time, @ 77°F(25°C), 50% RH:
Drying and recoat times are temperature, humidity and film thickness dependent.

Touch: 30 minutes

Recoat: as a primer 1 hour

as a stain sealer: 4 hours

with a Hi-Performance Finish 24 hours

Flash Point: N/A

Finish: 0-5 units @ 60°

Tinting with CCE only:

Base oz/gal Strength

White 0 - 2 Sher-Color

Vehicle Type: Acrylic

B51W00150

VOC (less exempt solvents):

<50 g/L; <0.42 lb/gal

As per 40 CFR 59.406 and SOR/2009-264, s.12

Volume Solids: 30 ± 2%

Weight Solids: 47 ± 2%

Weight per Gallon: 10.93 lb (4.96 kg)

Tinting

May be tinted with no more than 2 oz. of ColorCast Ecotoner® per gallon. Do not exceed 2 ounces per gallon of total colorant. Check color before use. For best topcoat color development, use the recommended "P"-shade primer.

When spot priming on some surfaces, a non-uniform appearance of the final coat may result, due to differences in holdout between primed and unprimed areas. To avoid this, prime the entire surface rather than spot priming. See Exterior Use if priming pre-finished metal surfaces.

Must be topcoated within 14 days with oil/alkyd, latex, epoxy, urethane, and lacquer topcoats.

SURFACE PREPARATION

WARNING! Removal of old paint by sanding, scraping or other means may generate dust or fumes that contain lead. Exposure to lead dust or fumes may cause brain damage or other adverse health effects, especially in children or pregnant women. Controlling exposure to lead or other hazardous substances requires the use of proper protective equipment, such as a properly fitted respirator (NIOSH approved) and proper containment and cleanup. For more information, call the National Lead Information Center at **1-800-424-LEAD** (in US) or contact your local health authority.

Remove all surface contamination by washing with an appropriate cleaner, rinse thoroughly and allow to dry. Existing peeled or checked paint should be scraped and sanded to a sound surface. Glossy surfaces should be sanded dull. Recognize that any surface preparation short of total removal of the old coating may compromise the service length of the system.

Testing - On hard, slick, glossy, or otherwise hard to paint surfaces, after preparing the surface, apply a test area of this primer, allow to dry properly and test for adhesion. Because of the exceptional adhesion of this product, sanding may not be necessary for most clean, paintable surfaces.

Sanding or dulling with an abrasive cleaner is recommended on glossy, extremely hard surfaces for maximum adhesion.

Stains from heavy water, smoke, ink, pencil, grease, etc. should be sealed with the appropriate primer/sealer.



**SHERWIN
WILLIAMS.**

EXTREME BOND™

Interior/Exterior Bonding Primer

B51W00150 (US)
B51WQ0150 (Canada)

<u>SURFACE PREPARATION</u>	<u>SURFACE PREPARATION</u>	<u>CAUTIONS</u>
<p>Due to the wide variety of substrates, surface preparation methods, application methods, and environments, one should test the complete system for adhesion, compatibility and performance prior to full scale application.</p> <p>Aluminum and Galvanized Wash to remove any oil, grease, or other surface contamination. All corrosion must be removed with sandpaper, wire brush, or other abrading methods.</p> <p>Ceramic Tile/ Glazed Block and Brick/ Porcelain After removing all surface contamination, the surface should be scuff sanded or scrubbed with an abrasive cleaner to dull the surface for best adhesion. Tile - Tile, laminate, ceramic and plastic tiles, and similar glossy surfaces, must be free of all oil, grease, and soap residue. Glass Apply Extreme Bond directly to glass that has been thoroughly cleaned.</p> <p>CAUTION: Any opaque coating will block light, which then causes an increase in the surface temperature of the glass. Dark colors will get hotter than light colors. In tightly fitted glass, any increase in the temperature of the glass will cause some expansion of the glass, which may cause it to shatter.</p> <p>Plastic/Vinyl/PVC/Fiberglass/ Formica After removing all surface contamination, the surface should be scuff sanded or scrubbed with an abrasive cleaner to dull the surface for best adhesion.</p> <p>Plastic: Due to the diverse nature of plastic substrates, a coating or coating system must be tested for acceptable adhesion to the substrate prior to use in production. Reground and recycled plastics along with various fire retardants, flowing agents, mold release agents, and foaming/blowing agents will affect coating adhesion. Please consult your Sherwin- Williams Representative for system recommendations.</p>	<p>Mildew Prior to attempting to remove mildew, it is always recommended to test any cleaner on a small, inconspicuous area prior to use. Bleach and bleaching type cleaners may damage or discolor existing paint films. Bleach alternative cleaning solutions may be advised. Mildew may be removed before painting by washing with a solution of 1 part liquid bleach and 3 parts water. Apply the solution and scrub the mildewed area. Allow the solution to remain on the surface for 10 minutes. Rinse thoroughly with water and allow the surface to dry before painting. Wear protective eyewear, waterproof gloves, and protective clothing. Quickly wash off any of the mixture that comes in contact with your skin. Do not add detergents or ammonia to the bleach/water solution.</p> <p>Do not use hydrocarbon containing solvents such as mineral spirits. When cleaning the surface use only a waterbased emulsifying detergent.</p> <p style="text-align: center;"><u>APPLICATION</u></p> <p>When the air temperature is at 35°F(1.7°C) substrates may be colder; prior to painting, check to be sure the air, surface, and material temperature are above 35°F(1.7°C) and at least 5°F above the dew point. Avoid using if rain or snow is expected within 2-3 hours. Air and surface temperatures must not drop below 35°F(1.7°C) for 48 hours after application.</p> <p>Do not reduce for stain blocking. No reduction necessary. Brush - Use a nylon/polyester brush. Roller - Use a 3/8" nap soft woven roller cover. Spray—Airless Pressure..... 2000 psi Tip015"-.021"</p>	<p><u>CAUTIONS</u></p> <p>Protect from freezing. Non-photochemically reactive. Do not use this product in areas subject to excessive water, e.g., in showers, around sinks, or on tubs. Not for use on floors. For large exterior pre-finished metal surfaces such as siding, use DTM Bonding Primer. Do not use on large surfaces of exterior wood. Does not adhere to polypropylene, polyethylene, or thermoplastic polyolefins.</p> <p>HOTW 12/08/2016 B51W00150 06 00 SP, FRC</p> <p style="text-align: center;"><u>CLEANUP INFORMATION</u></p> <p>Clean spills, spatters, hands and tools with soap and warm water. After cleaning, flush spray equipment with compliant cleanup solvent to prevent rusting of the equipment. Follow manufacturer's safety recommendations when using solvents.</p> <p>The information and recommendations set forth in this Product Data Sheet are based upon tests conducted by or on behalf of The Sherwin-Williams Company. Such information and recommendations set forth herein are subject to change and pertain to the product offered at the time of publication. Consult your Sherwin-Williams representative or visit www.paintdocs.com to obtain the most current version of the PDS and/or an SDS.</p>

Resilience®

Exterior Latex Satin

K43-Series


**SHERWIN
WILLIAMS®**

CHARACTERISTICS

Resilience Exterior is a high quality exterior finish with MoistureGuard™ Technology for excellent early moisture resistance. This product, which has improved resistance to early dirt pick up, is recommended for use on aluminum and vinyl siding, wood siding, clapboard, shakes, shingles, plywood, masonry, and metal down to a surface and air temperature of 35°F.

VinylSafe™ paint colors allow you the freedom to choose from 100 color options, including a limited selection of darker colors formulated to resist warping or buckling when applied to a surface, stable vinyl substrate.

Color: Most Colors

Coverage: 350-400 sq. ft. per gallon
@ 4 mils wet; 1.6 mils dry

Drying Time, @ 50% RH:

	@ 35-45°F	@ 45°F +
Touch:	2 hours	2 hours
Recoat:	24-48 hours	4 hours

Drying and recoat times are temperature, humidity, and film thickness dependent

Finish: 10-20 units @ 60°

Tinting with CCE only:

Base:	oz. per gallon	Strength:
Extra White	0-7	SherColor
Deep Base	4-12	SherColor
Ultradeep Base	10-12	SherColor
Light Yellow	0-12	SherColor
Primary Red	0-12	SherColor
Vivid Yellow	0-12	SherColor

Extra White K43W00051

(may vary by color)

VOC (less exempt solvents):

less than 50 grams per litre; 0.42 lbs. per gallon

As per 40 CFR 59.406

Volume Solids:	38 ± 2%
Weight Solids:	52 ± 2%
Weight per Gallon:	10.57 lbs
Flash Point:	N/A
Vehicle Type:	100% Acrylic
Shelf Life:	36 months unopened
WVP Perms (US)	25.11 grains/(hr ft ² in Hg)

Mildew Resistant

This coating contains agents which inhibit the growth of mildew on the surface of this coating film.

COMPLIANCE

As of 08/27/2020, Complies with:

OTC	Yes
OTC Phase II	Yes
SCAQMD	Yes
CARB	Yes
CARB SCM 2007	Yes
Canada	Yes
LEED® v4 & v4.1 Emissions	N.A.
LEED® v4 & v4.1 VOC	Yes
EPD-NSF® Certified	N.A.
MIR-Manufacturer Inventory	N.A.
MPI®	Yes

APPLICATION

When the air temperature is at 35°F, substrates may be colder; prior to painting, check to be sure the air, surface, and material temperature are above 35°F and at least 5°F above the dew point. Avoid using if rain or snow is expected within 1-1^{1/2} hours.

Do not apply at air or surface temperatures below 35°F or when air or surface temperatures may drop below 35°F within 48 hours.

No reduction necessary.

Brush: Use a nylon-polyester brush.

Roller: Use a high quality 3/8-3/4 inch nap synthetic roller cover.

For specific brushes and rollers, please refer to our Brush and Roller Guide on Sherwin-Williams.com

Spray—Airless
Pressure 2000 p.s.i.
Tip .015-.019 inch

APPLICATION TIPS

Make sure product is completely agitated (mechanically or manually) before use.

SPECIFICATIONS

Aluminum & Aluminum Siding¹, Galvanized Steel¹

2 coats Resilience Exterior Latex

Concrete Block, CMU, Split face Block

1 coat Loxon Acrylic Block Surfacers

2 coats Resilience Exterior Latex

Brick, Stucco, Cement, Concrete

1 coat Loxon Concrete and Masonry Primer³ or

Loxon Conditioner²

2 coats Resilience Exterior Latex

Cement Composition Siding/Panels

1 coat Loxon Concrete and Masonry Primer³ or

Loxon Conditioner²

2 coats Resilience Exterior Latex

Plywood

1 coat Exterior Latex Primer

2 coats Resilience Exterior Latex

***Vinyl Siding**

2 coats Resilience Exterior Latex

Wood, Composition Board (Cedar, Redwood)⁴

1 coat Exterior Oil-Based Wood Primer²

2 coats Resilience Exterior Latex

¹ On large expanses of metal siding, the air, surface, and material temperatures must be 50°F or higher.

² Not for use at temperatures under 50°F. See specific primer label for that product's application conditions.

³ Not for use at temperatures under 40°F. See specific primer label for that product's application conditions.

⁴ Knots and some woods, such as redwood and cedar, contain a high amount of tannin, a colored wood extract. For best results on these woods, use a coat of Exterior Oil-Based Wood Primer.

Other primers may be appropriate.

When repainting involves a drastic color change, a coat of primer will improve the hiding performance of the topcoat color.

Resilience®

Exterior Latex Satin

SURFACE PREPARATION

WARNING! Removal of old paint by sanding, scraping or other means may generate dust or fumes that contain lead. Exposure to lead dust or fumes may cause brain damage or other adverse health effects, especially in children or pregnant women. Controlling exposure to lead or other hazardous substances requires the use of proper protective equipment, such as a properly fitted respirator (NIOSH approved) and proper containment and cleanup. For more information, call the National Lead Information Center at **1-800-424-LEAD** (in US) or contact your local health authority.

Remove all surface contamination by washing with an appropriate cleaner, rinse thoroughly and allow to dry. Existing peeled or checked paint should be scraped and sanded to a sound surface. Glossy surfaces should be sanded dull. Stains from water, smoke, ink, pencil, grease, etc. should be sealed with the appropriate primer-sealer. Recognize that any surface preparation short of total removal of the old coating may compromise the service length of the system.

Aluminum and Galvanized Steel:

Wash to remove any oil, grease, or other surface contamination. All corrosion must be removed with sandpaper, wire brush, or other abrading method.

Cement Composition Siding-Panels:

Remove all dirt, dust, grease, oil, loose particles, laitance, foreign material, and peeling or defective coatings. Allow the surface to dry thoroughly. If the surface is new, test it for pH, if the pH is higher than 9, prime with Loxon Concrete & Masonry Primer.

Caulking:

Gaps between windows, doors, trim, and other through-wall openings can be filled with the appropriate caulk after priming the surface.

Concrete, Masonry, Cement, Block:

All new surfaces must be cured according to the supplier's recommendations—usually about 30 days. Remove all form release and curing agents. Rough surfaces should be filled to provide a smooth surface. If painting cannot wait 30 days, allow the surface to cure 7 days and prime the surface with Loxon Concrete & Masonry Primer. Cracks, voids, and other holes should be repaired with an elastomeric patch or sealant. **Concrete masonry units (CMU)** - Surface should be thoroughly clean and dry. Air, material and surface temperatures must be at least 50°F (10°C) before filling. Use Loxon Acrylic Block Surfer. The filler must be thoroughly dry before topcoating.

Stucco:

Remove any loose stucco, efflorescence, or laitance. Allow new stucco to cure at least 30 days before painting. If painting cannot wait 30 days, allow the surface to dry 7 days and prime with Loxon Concrete & Masonry Primer. Repair cracks, voids, and other holes with an elastomeric patch or sealant.

SURFACE PREPARATION

Mildew:

Prior to attempting to remove mildew, it is always recommended to test any cleaner on a small, inconspicuous area prior to use. Bleach and bleaching type cleaners may damage or discolor existing paint films. Bleach alternative cleaning solutions may be advised.

Mildew may be removed before painting by washing with a solution of 1 part liquid bleach and 3 parts water. Apply the solution and scrub the mildewed area. Allow the solution to remain on the surface for 10 minutes. Rinse thoroughly with water and allow the surface to dry before painting. Wear protective eyewear, waterproof gloves, and protective clothing. Quickly wash off any of the mixture that comes in contact with your skin. Do not add detergents or ammonia to the bleach-water solution.

Previously Painted Surfaces:

If in sound condition, clean the surface of all foreign material. Smooth, hard or glossy coatings and surfaces should be dulled by abrading the surface. Apply a test area, allowing paint to dry one week before testing adhesion. If adhesion is poor, additional abrasion of the surface and/or removal of the previous coating may be necessary. Retest surface for adhesion. If paint is peeling or badly weathered, clean surface to sound substrate and treat as a new surface as above. Recognize that any surface preparation short of total removal of the old coating may compromise the service length of the system.

Steel:

Rust and mill scale must be removed using sandpaper, wire brush, or other abrading method. Bare steel must be primed the same day as cleaned.

***Vinyl or other PVC Building Products:**

Clean the surface thoroughly by scrubbing with warm, soapy water. Rinse thoroughly, if needed prime with appropriate white primer. Do not paint vinyl with any color darker than the original color or having a Light Reflective Value (LRV) of less than 56 unless VinylSafe® Colors are used. If VinylSafe colors are not used the vinyl may warp. Follow all painting guidelines of the vinyl manufacturer when painting. Only paint properly installed vinyl siding. Deviating from the manufacturer's painting guidelines may cause the warranty to be voided.

Wood, Plywood, Composition Board:

Clean the surface thoroughly then sand any exposed wood to a fresh surface. Patch all holes and imperfections with a wood filler or putty and sand smooth. All new and patched areas must be primed. Knots and some woods, such as redwood and cedar, contain a high amount of tannin, a colored wood extract. If applied to these bare woods, it may show some staining. If staining persists, spot prime severe areas with 1 coat of Exterior Oil-Based Wood Primer prior to using.

CAUTIONS

For Exterior use only

Protect from freezing

Non-photochemically reactive

Not for use on floors.

Before using, carefully read **CAUTIONS on label**

ZINC: Use only with adequate ventilation. To avoid overexposure, open windows and doors or use other means to ensure fresh air entry during application and drying. If you experience eye watering, headaches, or dizziness, increase fresh air, or wear respiratory protection (NIOSH approved) or leave the area. Avoid contact with eyes and skin. Wash hands after using. Keep container closed when not in use. Do not transfer contents to other containers for storage. **FIRST AID:** In case of eye contact, flush thoroughly with large amounts of water. Get medical attention if irritation persists. If swallowed, call Poison Control Center, hospital emergency room, or physician immediately. **WARNING:** This product contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. **DO NOT TAKE INTERNALLY. KEEP OUT OF THE REACH OF CHILDREN.**

HOTW 08/27/2020 K43W00051 42 39
FRC, SP

CLEANUP INFORMATION

Clean spills, spatters, hands and tools immediately after use with soap and warm water. After cleaning, flush spray equipment with compliant cleanup solvent to prevent rusting of the equipment. Follow manufacturer's safety recommendations when using solvents.